
655 Eisenhower Drive
Owatonna, MN 55060 USA
Phone: (507) 455-7000
Tech. Serv.: (800) 533-6127
Fax: (800) 955-8329
Order Entry: (800) 533-6127
Fax: (800) 283-8665
International Sales: (507) 455-7290
Fax: (507) 455-7063

Form No. 107117

Operating Instructions for: **6484 (511552)**


Ford Timing Chain Tensioner Tool

Application: 1997 – 2011 4.0L SOHC Explorer (V6), Mountaineer (V6), Ranger (VIN E)
1997 – 2008 4.0L SOHC Explorer, Mountaineer, Ranger (VIN X)
2005 – 2010 4.0L SOHC Mustang (VIN N)

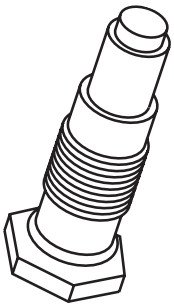


NOTE: Same as Ford No. 303-571 (T97T-6K254-A).

1. Remove the hydraulic chain tensioner from the engine.
2. Install tool No. 6484 (511552) into the engine to hold pressure on the timing chain during the cam timing procedure.
3. Adjust camshaft timing according to instructions in the vehicle service manual.
4. Torque fasteners to factory specifications.

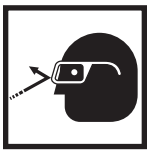

⚠ WARNING: Wear eye protection that meets ANSI Z87.1 and OSHA standards.

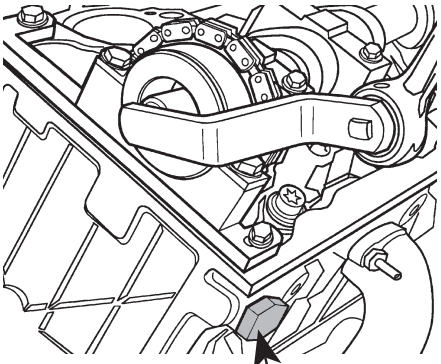

No. 6484 (511552)

© Bosch Automotive Service Solutions LLC
July 25, 2014 Rev. C


655 Eisenhower Drive
Owatonna, MN 55060 USA
Phone: (507) 455-7000
Tech. Serv.: (800) 533-6127
Fax: (800) 955-8329
Order Entry: (800) 533-6127
Fax: (800) 283-8665
International Sales: (507) 455-7290
Fax: (507) 455-7063

Form No. 107117

Operating Instructions for: **6484 (511552)**


Ford Timing Chain Tensioner Tool

Application: 1997 – 2011 4.0L SOHC Explorer (V6), Mountaineer (V6), Ranger (VIN E)
1997 – 2008 4.0L SOHC Explorer, Mountaineer, Ranger (VIN X)
2005 – 2010 4.0L SOHC Mustang (VIN N)

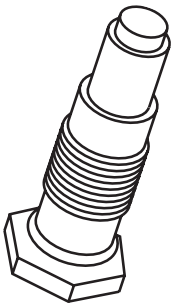


NOTE: Same as Ford No. 303-571 (T97T-6K254-A).

1. Remove the hydraulic chain tensioner from the engine.
2. Install tool No. 6484 (511552) into the engine to hold pressure on the timing chain during the cam timing procedure.
3. Adjust camshaft timing according to instructions in the vehicle service manual.
4. Torque fasteners to factory specifications.

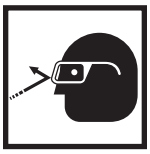

⚠ WARNING: Wear eye protection that meets ANSI Z87.1 and OSHA standards.

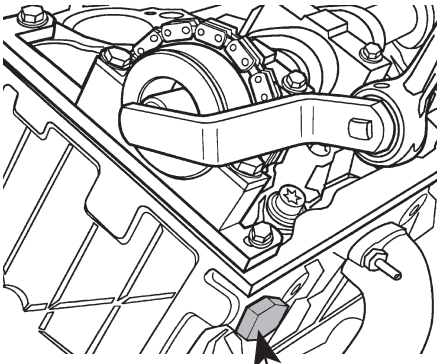

No. 6484 (511552)

© Bosch Automotive Service Solutions LLC
July 25, 2014 Rev. C